

## How to wire a surface mount box

### Parts List:

- SMB series surface mount box
- Wire cutters
- Jacket stripping tool
- 110 tool



**Online Video**


[www.L-com.com/Videos/A18](http://www.L-com.com/Videos/A18)

#### STEP 1




Remove cover and attach the jack base assembly using the supplied screws or double stick tape.

#### STEP 2

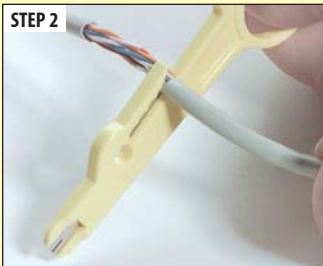


Remove approximately 3" of the outer jacket from the cable. Take care not to nick the wires.

#### STEP 3

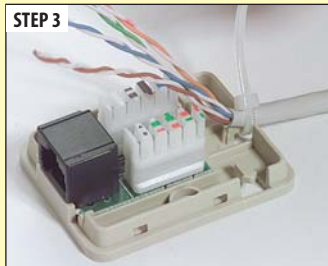


Secure the cable with a cable tie to the desired entry point.

#### STEP 4

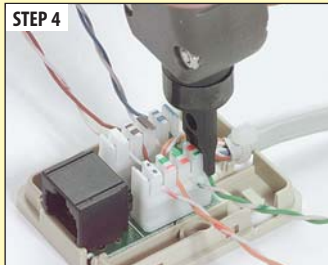


Insert the pairs to the color coded slots taking care to maintain the conductor twist at the IDC terminal. Punch down using a 110 style tool.

#### STEP 5

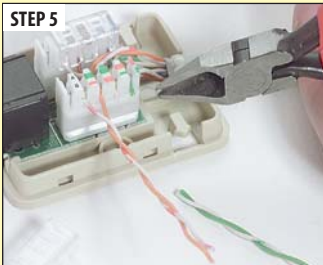

Trim excess wire (if your 110 tool doesn't cut) and snap on the retainer caps.

#### STEP 6

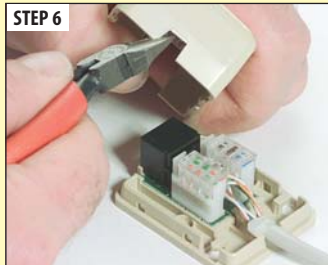

Notch the cover to match the cable entry and snap it in place.