

How to wire a surface mount box

Parts List:

- SMB series surface mount box
- Wire cutters
- Jacket stripping tool
- 110 tool



Online Video


www.L-com.com/Videos/A18

STEP 1




Remove cover and attach the jack base assembly using the supplied screws or double stick tape.

STEP 2

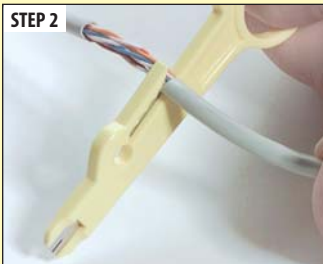


Remove approximately 3" of the outer jacket from the cable. Take care not to nick the wires.

STEP 3

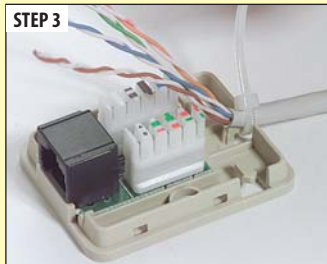


Secure the cable with a cable tie to the desired entry point.

STEP 4

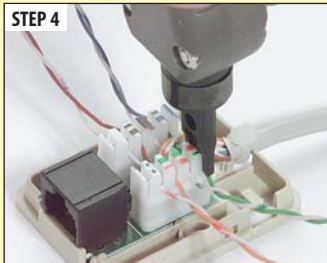


Insert the pairs to the color coded slots taking care to maintain the conductor twist at the IDC terminal. Punch down using a 110 style tool.

STEP 5

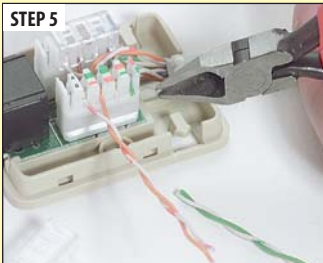

Trim excess wire (if your 110 tool doesn't cut) and snap on the retainer caps.

STEP 6

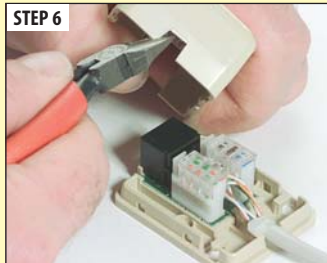

Notch the cover to match the cable entry and snap it in place.